

TECHNICAL DATA

Category:


Specchi nel Tempo

I.D. Item :

VENERE

Standard size : 1.250 x 2.450 mm

Available thicknesses : 3- 4 - 5 - 6 mm

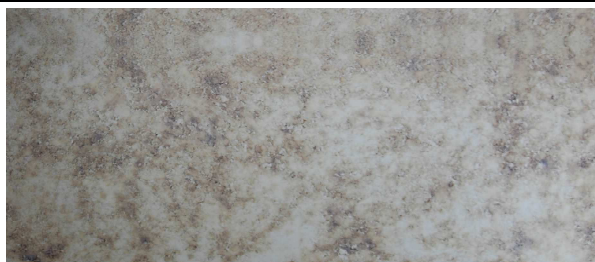

Venere

Technical Specifications

Cutting	:	Vegetable white mineral oil (Ex: ENOTAP Fenzi)
Grinding	:	Swipe edges before grinding. Seal edges with appropriate painting to avoid humidity infiltration after grinding.
Drilling	:	like traditional mirror
Beveling	:	like traditional mirror
Lamination	:	NO
Tempering	:	NO
Bending	:	NO
Safety Film	:	YES (only on cut to sizes pieces)
Bonding	:	YES (with neutral silicon adhesive for mirror Ex. Neosil 00400 - Dowsil 817 Dow Corning)
		The glue used does not have to contain alcohol-solvent or acid chemical elements.
		The compatibility of each double-sided tape needs to be tested before installation.
		Before installation, the fixer must test the glue used for the specific application.
		The choice of the glue and double-sided tape is under the sole responsibility of the client/installer.
Heat resistance	:	Up to 50 ° C
Moisture resistance	:	Can be used in bathroom, kitchen with normal humidity level
Care	:	Use a clean soft cloth and regular product for cleaning mirrors
Note	:	The excessive use of cutting oils may alter the protective coat of paint at the back of the mirror. We recommend to wash the mirror immediately after cutting and to use paper interleaving
Videos	:	https://drive.google.com/open?id=1J_5Rhi5kU_LQ5oSAOqi6tM45e4USTeYt

Packaging

Thickness	Sheets	MQ	Weight (Kg)
3 mm	30	91,87	730
4 mm	22	67,37	715
5 mm	18	55,12	730
6 mm	15	45,93	730

In all wooden cases you will find technical notes about handling and installing our mirrors.



General Notes

Application	-	ONLY Interior (Furniture, Tables, Shelves, cupboard doors, wall cladding ecc...)
Regulation	-	No regulation applicable for this product
Cut to size	-	On request
New pattern design	-	On request
Warranties	-	Handmade antique mirror glass : None
Samples	-	85 * 150 MM available

The installer is responsible for the product after installation. Any claim reported after the installation won't be accepted

The presence of small oxidations or blind spots are part of the unique style of mirrors artificially aged. This is purposely done to obtain a vintage effect.

These aesthetic changes may happen later after the installation.

Being created by handmade processes no two portions of the same mirror will be exactly equal.